STATE OF ALASKA

DEPARTMENT OF NATURAL RESOURCES

DIVISION OF GEOLOGICAL AND GEOPHYSICAL SURVEYS

Steve Cowper, Governor

Judith M. Brady, Commissioner

Robert B. Forbes, Director and State Geologist

August 1987

This report is a preliminary publication of DGGS. The author is solely responsible for its content and will appreciate candid comments on the accuracy of the data as well as suggestions to improve the report.

Report of Investigations 87-17
WATER-WELL DATA FROM THE HOUSTON AREA,
MATANUSKA-SUSITNA BOROUGH, ALASKA
In cooperation with the City of Houston,
Alaska

by Danita L. Maynard

STATE OF ALASKA Department of Natural Resources DIVISION OF GEOLOGICAL & GEOPHYSICAL SURVEYS

According to Alaska Statute 41, the Alaska Division of Geological and Geophysical Surveys is charged with conducting 'geological and geophysical surveys to determine the potential of Alaskan land for production of metals, minerals, fuels, and geothermal resources; the locations and supplies of ground water and construction materials; the potential geologic hazards to buildings, roads, bridges, and other installations and structures; and shall conduct such other surveys and investigations as will advance knowledge of the geology of Alaska.'

In addition, the Division of Geological and Geophysical Surveys shall collect, record, evaluate, and distribute data on the quantity, quality, and location of underground, surface, and coastal water of the state; publish or have published data on the water of the state and require that the results and findings of surveys of water quality, quantity, and location be filed; require that water-well contractors file basic water and aquifer data, including but not limited to well location, estimated elevation, well-driller's logs, pumping tests, flow measurements, and water-quality determinations; accept and spend funds for the purposes of this section, AS 41.08.017 and 41.08.035, and enter into agreements with individuals, public or private agencies, communities, private industry, and state and federal agencies; collect, record, evaluate, archive, and distribute data on seismic events and engineering geology of the state; and identify and inform public officials and industry about potential seismic hazards that might affect development in the state.

Administrative functions are performed under the direction of the Director, who maintains his office in Fairbanks. The locations of DGGS offices are listed below:

.794 University Avenue (Suite 200) Fairbanks, Alaska 99709 (907)474-7147 .400 Willoughby Avenue (3rd floor) Juneau, Alaska 99801 (907)465-2533

.18225 Fish Hatchery Road P.O. Box 772116 Eagle River, Alaska 99577 (907)696-0070

This report is for sale by DGGS for \$3.50. DGGS publications may be inspected at the following locations. Mail orders should be addressed to the Fairbanks office.

.794 University Avenue (Suite 200) Fairbanks, Alaska 99709 .400 Willoughby Avenue (3rd floor) Juneau, Alaska 99801

.U.S. Geological Survey
Public Information Office
701 C Street
Anchorage, Alaska 99513

.Information Specialist U.S. Geological Survey 4230 University Drive, Room 101 Anchorage, Alaska 99508

CONTENTS

			Page
Geology. Well cha Water san Ground-w Well inf Acknowle	racter mpling ater q ormati dgment	ristics. g and analyses. quality. lon.	1 1 2 2 4 6 6
		FIGURES	
Figure	1. 2.	Bar chart showing reported water well depths in the study area Bar chart showing reported well yields in the study area	3
		TABLES	
Table	1. 2. 3.	Water quality field data for the Houston, Alaska area Laboratory analysis of ground water in the Houston, Alaska, area	7 8 9
		PLATES	
Plate	1.	Map showing well locations in the vicinity of Houston, Alaska	

INTRODUCTION

This report is the second in a series of ground-water data compilation reports prepared by the Alaska Division of Geological and Geophysical Surveys (DGGS). The work was funded jointly by DGGS and the City of Houston, Alaska. The compilation summarizes local ground-water conditions and is intended to facilitate land-use planning by providing reconnaissance hydrogeological information. Data for the report were obtained from the files of DGGS, the United States Geological Survey (USGS), and the Alaska Department of Environmental Conservation (DEC). Additional information was obtained from responses to a questionnaire mailed to property owners in the area.

The locations of 38 wells throughout the area were verified and water levels measured. Water from 32 wells was sampled and tested on-site for temperature, pH, conductivity, hardness, and iron. Water samples from eight wells were also analyzed for major ions and selected trace metals at DGGS laboratory facilities in Fairbanks, Alaska.

GEOLOGY

The Houston area lies within the lower Susitna basin and is bounded to the south by the Little Meadow Creek area, to the north by the Zero Lake area, to the east by Cheri Lake, and to the west by Pear Lake. The Little Susitna River provides the major drainage in the area (pl. 1).

The major structural feature of the area is the Castle Mountain Fault, which Turner and Wescott (1982) described as a high angle reverse fault (north-side upthrown) with a vertical offset in excess of 10,000 ft. They also suggested that additional subsurface faults may be present but obscured by glacial drift. The following discussion is summarized from Turner and Wescott (1982).

Exploration wells drilled in the lower Susitna basin have encountered granitic rocks at depth which are believed to be continuous with the Tertiary-to-Cretaceous-age granitic batholith of the Talkeetna Mountains northeast of Houston. The granitic rocks are overlain by thousands of feet of coalbearing Tertiary-age sedimentary rocks. A gravity survey of the area indicates the sedimentary section north of the Castle Mountain fault is about 2,000 ft thick. South of the fault the sedimentary section is estimated to be at least 12,000 ft thick. These sedimentary rocks are composed of sandstone, siltstone, claystone, and coal, similar to the coal-bearing rocks of the Chickaloon Formation.

Reger (1981) and Trainer (1960) have discussed the Quaternary-age glacial drift and alluvial deposits which overlie the sedimentary rocks. These deposits vary in thickness from 0 ft to over 180 ft. The glacial drift is composed principally of till, an undifferentiated mixture ranging from clay-size particles to boulders, and glaciofluvial deposits, consisting mostly of gravel and sand. The glaciofluvial deposits may be well-sorted gravel or gravelly sand deposits, typical of former glacial meltwater streams, or well- to poorly-sorted gravel, sand, and silt mixtures deposited by meltwater in and beneath glacial ice. Relatively permeable alluvial deposits of gravel

and sand are present along the Little Susitna River and Little Meadow Creek. The land surface over most of the Houston area is overlain by a thin (4-12 in.) blanket of loess, or wind-blown silt (Reger, 1981).

Local water supplies are generally obtained from the gravel and sand layers of the near-surface glaciofluvial or alluvial deposits. Ground-water supplies in a few instances are also obtained from the sandstone and coal layers within the buried sedimentary rock sequence.

WELL CHARACTERISTICS

The 220 wells in the Houston area for which DGGS has information range from 12 to nearly 300 ft in depth (fig. 1). Approximately half of these (125) are 30-90 ft deep. Depths of wells can vary substantially even when wells are in proximity. The percentage of wells drilled deeper than 100 ft is higher north of Loon Lake (T. 18 N.). Estimated well yields (as recorded on well logs or reported by homeowners) range from 2-3 gallons per minute (gpm) in domestic bedrock wells to 150-250 gpm from institutional wells at the Houston Junior-Senior High School and the Big Lake Fish Hatchery operated by Alaska Department of Fish and Game (fig. 2). Private supply wells in the area typically have reported yields up to 30 gpm. These figures generally agree with Feulner (1971) who estimated the potential yields of aquifers within the glacial deposits at 10-50 gpm. In areas immediately adjacent to the Little Susitna River, however, Feulner estimated the potential yield to be 50-1,000 gpm. Yields of this magnitude are not usually achieved in private, domestic wells, which are commonly unscreened and unperforated, but greater yields may be produced using more expensive well designs associated with commercial or public water supplies.

Twenty-six static water-level measurements were taken during the course of the study (table 1) using a steel tape or electric sounder. Water levels were considered static when readings taken one to two minutes apart did not differ by more than 0.01 ft. Sixteen of the measurements were taken in wells for which previous measurements were available from drillers' logs (table 3). In 10 instances, water levels measured by DGGS personnel were 1-21 ft higher than measurements recorded on drillers' logs. The discrepancies are most likely attributable to differences in technique, an initial measurement taken before the water in the well bore had risen to its final, static level, or a higher water level. The level of water in a given well can fluctuate seasonally (for example, levels are typically lowest in late winter/early spring) or annually (higher in wetter years).

In six wells, water levels obtained by DGGS personnel were 2-13 ft lower than those reported by drillers. Discrepancies in this case may be due to an actual lowered water table, may reflect cyclical changes or differences in measurement technique as discussed previously, or may be due to a measurement recorded as static when the water level was rising very slowly.

WATER SAMPLING AND ANALYSIS

Ground-water samples were obtained from ordinary household plumbing taps. The taps were allowed to run until the water temperature stabilized,

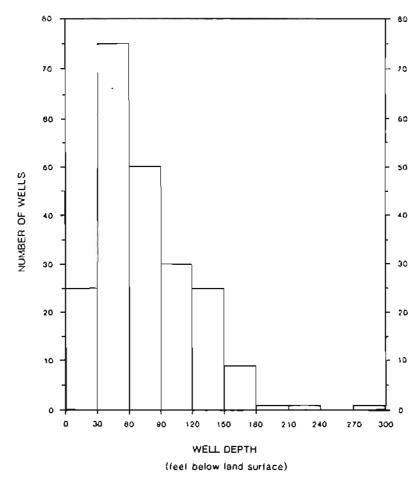


Figure 1. Reported water well depths in the study area.

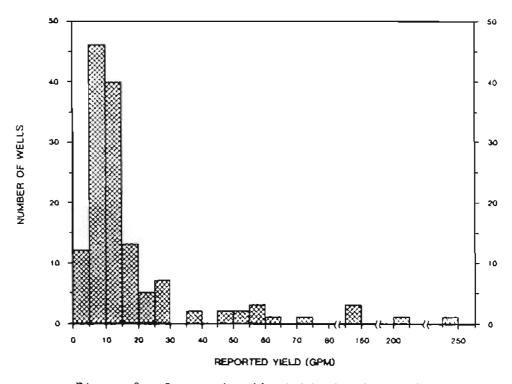


Figure 2. Reported well yields in the study area.

and the wellbore and pressure tank were assumed to have been flushed. Field tests were performed using a Hach Total Hardness Test Kit, a Hach Iron Test Kit, Electrolytic Conductivity Measuring Set, an Orion Research digital pH meter, and a Model 4041 Hydrolab. The results of the field tests are summarized in table 1. Eight samples were filtered and preserved in the field and refrigerated prior to shipment to the DGGS laboratory in Fairbanks, Alaska, where analyses were performed according to U.S. EPA or American Public Health Association (APHA) methods. Results of the laboratory testing are summarized in table 2.

GROUND-WATER QUALITY

Water can exhibit varied chemical characteristics, depending on the amount and nature of dissolved material present in the form of inorganic salts, small amounts of organic matter, and small amounts of dissolved gases. The results of sampling done for this study show that ground water in the Houston area is typified by total dissolved solids (TDS) less than 1,000 mg/L, pH values slightly above 7.0, and hardness values above 60 mg/L. Calcium, magnesium, and bicarbonate ions dominate. This is typical of water contained in glacial deposits derived from granitic rock types, but which has also had contact with carbonate minerals (Freeze and Cherry, 1979).

The water is generally of good quality, lacking objectionable taste or odor. Some homeowners in T.17 N., R. 3 W., secs. 2 and 13 feel the ground water in their area contains undesirable amounts of dissolved iron.

Exceptions to the good water quality occur in T. 18 N., R. 3 W., sec. 21. In that section, three neighboring wells (sec. 21, map numbers 2 and 15) produce water of lower quality, evidenced by occasional 'rotten egg' odor typical of the presence of hydrogen sulfide, conductivity values in excess of 650 µs, and pH values greater than 9. Water samples from one well were selected for laboratory analysis, and the results show high levels of sodium and orthophosphate, and low levels of calcium and sulfate (table 2, sample 21-2).

The analyses are consistent with results of other studies of sandstone aquifers containing local clay horizons (Freeze and Cherry, 1979). The results could be attributed to geochemical processes involving exchange of calcium for sodium in clay minerals and the oxidation of organic matter by sulfate.

In the study area, sodium levels greater than 50 mg/L appear to be characteristic of ground water in the bedrock aquifer only. Among samples taken from wells finished in sand and gravel aquifers, sodium levels range from 2.07 mg/L to 34.4 mg/L (table 2). The ratio of sodium to calcium and magnesium appears to be higher in the area north of the Castle Mountain fault and the Little Susitna River. The total number of samples analyzed, however, was too low to provide statistically definitive trends.

Trace and nuisance elements for which tests were made are present in small amounts, often below instrument detection limits. Two exceptions are samples 13-18 and 21-2, which contain anomalously high amounts of

orthophosphate (4.8 mg/L and 8.23 mg/L, respectively). Phosphorus is generally present in natural waters at concentrations of less than 1 mg/L (Hem, 1985). Orthophosphate concentrations of approximately 6 mg/L have been associated with weak domestic sewage (Canter, 1985). However, ground water contaminated with septic system effluent typically exhibits elevated levels of chloride and nitrate (Sawyer and McCarty, 1978; Freeze and Cherry, 1979), which is not the case in these samples. Additional data would be necessary to determine if these values are a result of local ground-water contamination from septic systems.

Field measurements were made for pH, specific conductivity, iron, hardness, and temperature (table 1); 8 of 9 pH measurements were within the normal range for ground water ($^{\circ}6.0-8.5$). The value of 9.4 for section 21, map number 2, is high.

Specific conductivity values, used to estimate the dissolved-solids content of a water supply, were generally low (less than 350 μs). However, 4 samples (from the three bedrock wells in section 21) had conductivities which ranged from 660 to 1,190 μs , indicating an anomalously high total dissolved-solids content.

Iron values determined in the field for 20 samples ranged from 0.1 to 1.0 mg/L. Two samples, in T. 17 N., R. 3 W., sec. 13 and T. 18 N., R. 3 W., sec. 23, showed values of 5.0 mg/L iron. The maximum concentration of iron acceptable in public drinking water systems is 0.3 mg/L (DEC, 1982). Higher levels may result in objectionable taste or staining of plumbing fixtures and laundry. Homeowners in T. 17 N., R. 3 W., sec. 2 complained of objectionable levels of iron. To correct this problem, they deepened their wells, or installed iron filters. High levels of iron or other metals sometimes occur in a sand and gravel aquifer overlying a silty or clayey layer. In such instances, ground water with a lower iron content may be contained in aquifers lying below the fine-grained layer.

Twenty-eight samples were tested in the field for hardness, a measure of the combined effects of calcium and magnesium (and, to a lesser extent, strontium, iron, and manganese). Water with a high degree of hardness may form scale and may react with soap to prevent foaming. Hem (1985) uses the following classification to describe water hardness:

Hardness range (in mg/L of CaCO ₃)	Description
0 - 60	soft
61 - 120	moderately hard
121 - 180	hard
more than 180	very hard

Using Hem's classification, 22 samples were moderately hard and four samples were hard. Samples from the three bedrock wells (section 21, map number 2; and section 21, map number 15, sequence numbers 1 and 2) yielded hardness values of 2-16 mg/L and would be classified as soft.

Turner and Wescott (1982) suggested that the lower Susitna basin has a high potential for geothermal ground water—ground water with a temperature higher than normally expected. In our investigation, 33 temperature measurements ranged from 3.5°C (38°F) to 10.0°C (50°F). This is slightly higher than average values for ground water in southcentral Alaska.

WELL INFORMATION

Table 3 contains information from well logs on file at DGGS offices as of May 1986. For further hydrogeologic information, please contact either DGGS (phone: 907-696-0070; P.O. Box 772116, Eagle River, AK 99577) or the U.S. Geological Survey (phone: 907-271-4138; 4230 University Drive, Suite 101, Anchorage, AK 99508-4664).

ACKNOWLEDGMENTS

This report benefited from contributions by several DGGS professionals: Bill Petrick, Jim Smith, Jenny Weir, Ed Collazzi and Bill Long. The Fairbanks laboratory performed the chemical analyses. Jim Munter, Steve Mack, and Mary Moorman reviewed the text. Alma Seward provided thoughtful review.

REFERENCES

- Alaska Department of Environmental Conservation, 1982, State of Alaska drinking water regulations: Department of Environmental Conservation Publication 18-2029, 20 p.
- Canter, L.W., 1985, Methods for the assessment of ground water pollution potential, $\underline{\text{in}}$ Ground Water Quality: New York, John Wiley and Sons, 547 p.
- Feulner, A.J., 1971, Water-resources reconnaissance of a part of the Matanuska-Susitna Borough, Alaska: U.S. Geological Survey Hydrologic Investigations Atlas HA-364, (scale 1:500,000, 1:250,000, 2 sheets).
- Freeze, R.A., and Cherry, J.A., 1979, Groundwater: Prentice-Hall, Inc., Englewood Cliffs, N.J., 604 p.
- Hem, J.D., 1970, Study and interpretation of the chemical characteristics of natural water (2d ed.): U.S. Geological Survey Water-Supply Paper 1473, 363 p.
- Reger, R.D., 1981, Geologic and materials maps of the Anchorage C-8 SE Quadrangle, Alaska: Alaska Division of Geological and Geophysical Surveys Geologic Report 65, (scale 1:25,000, 2 sheets).
- Sawyer, C.N., and McCarty, P.L., 1978, Chemistry for environmental engineering, (3d ed.): McGraw-Hill, New York, 532 p.
- Trainer, F.W., 1960, Geology and ground-water resources of the Matanuska Valley agricultural area, Alaska: U.S. Geological Survey Water-Supply Paper 1494, 116 p.
- Turner, D.L., and Wescott, E.M., 1982, A preliminary investigation of the geothermal energy resources of the Lower Susitna Basin: University of Alaska Geophysical Institute Report UAG R-287, Fairbanks, Alaska, 50 p.

Table 1. Water quality field data for the Houston, Alaska area.

		Wel.	l location			Depth to		Specific conduc-			
			Sequence	Мар		water	Temp.	tivity	Iron	Hardness	
T.	R.	Sec.	no.	no.	Date	(ft)	(°C)	(umhos)	(mg/L)	(mg/L)	pH
								()			~
1 7 N	3W	1	1	l	08-23-85	44					
17N	3W	2	1	3	09-20-85	31	3.5	90	0.3	75	7.9
17N	ЗW	2	1	6	07-25-85	84					
1 7 እ	3W	4	l	3	07-25 - 85		4.5	160	0.3	85	
17N	3W	8	l	1	08 - 05-85	15	4.0	175	0.4	110	
1 7N	3W	8	l	2	08-30 - 85	14	4.0	200	0.4	99	6.9
17N	3W	8	1	2	09-20-85		4.0	125			7.6
17א	3W	11	1	7	06-13 - 85	42	4.0	145	0.5	86	
17N	3W	12	1	2	08-05-85	28	6.0	200	0.6	116	
17א	3W	12	1	6	07-25-85	10	5.0	140		61	
17N	3₩	13	1	11	08-06-85	11	4.5		5.0	168	
L 7N	3W	13	l	15	08-06-85	32	4.0		0.4	87	
17N	3W	13	2	18	09-26-85	28	5.0	100	0.6	68	7.2
17N	3W	14	l	4	06-13-85	29	5.2	150	1.0	98	
17N	3W	15	1	4	08-06-85	19	4.0	~~	0.1	97	
181	ЗW	17	2	3	09-11-85	72	4.7	250		- <i>-</i>	7.2
18N	3W	21	l	2	08-06-85	18	3.0	660	0.4	16	
18N	3 W	21	1	2	09-11-85			985			9.4
18N	3W	21	l	15	08-05-85	~-	5.0	1190	0.3	2	
18N	3W	21	2	15	08-05-85		7.0	1130	0.1	5	
18N	3W	22	1	8	08-02-85	24	5.0	192	4.3	145	
18N	3W	22	1	9	08-23-85		3.0	330	1.0	93	
18N	3 W	22	l	9	09-20-85		4.0	190			8.2
18N	3₩	23	1	4	07-24-85		4.0	200	5.0	60	
181	3₩	23	2	5	07-24-85	5					
18N	3₩	23	1	6	08-30-85	18	4.5	190	1.5	130	
18N	3₩	25	l	5	07-24-85	104	5.0	150		88	
181	3W	25	1	7	09-26-85	- -	5.0	210	0.4	94	7.2
18N	3W	26	1	1	07-24-85	13	4.0	200		135	
18N	3W	26	1	2	09-26-85	- -	4.0	170	0.2	70	
18N	3W	26	I.	2	10-03-85	125	5.0	100			7.2
181	3₩	26	1	3	08-30-85	6	10.0	230		100	
18N	3W	26	1	3	02-26-86	7	9.5		1.0	99	
18N	3W	34	1	2	07-24-85	63	4.0	180		92	
18N	3W	35	1	1	07-18-85	63	6.0	230		73	
18N	3W	3 5	<u>i</u>	2	08-23-85		6.0	~-	1.2	80	
18N	3W	35	1	3	07-18-85	22	- <u>-</u>		_ _		~-
18N	3W	3 6	1	1	08-23-85	117	6.0		0.8	83	

⁻⁻ a not determined.

Table 2. Laboratory analyses of ground water in the Houston, Alaska area. Measurements other than gross alpha are in mg/L. Gross alpha is measured in picocuries perliter. Samples are identified by section number followed by map number,

	Sample locations and date													
Constituent	2-3 09-20-85	2-3 ^a 03-19-84	6-2 09-20-85	13-18 09-26-85	17-3 09-11-85	21-2 09-11-85	21-2 ^a 06-11-85	21-12 ⁸ 10-06-83	22-1 ^b 08-22-69	22-8 ⁸ 05-21-84	22-9 09-20-85	25-7 09-26-85	26-2 09-26-85	EPA/ ^C DEC
Sodium	2.07		4.69	5.22	8.54	232	260	27	4.5	6.3	34.4	3.58	3.16	250
Potassium	0.53		1.12	0.68	0.87	1.28	0.59	3.1	0.6		1.61	0.86	0.70	
Magnesium	1.10	**	1.47	1.68	1.47	0.69	0.30	25	3.1		2.51	2.01	1.36	
Calcium	4.01		6.67	5.00	5.30	tr	0.57		13		5.61	7.89	6.87	
Strontium	0.05		0.10	0.14	0.10	0.01	~-		0.1		0.31	0.12	0.08	
Barium	< 0.001	< 0.05	0.01	< 0.001	0.036	< 0.001	0.010		0.1	0.029	0.042	< 0.001	< 0.001	1
Sulfate	1.28		2.80	3.87	0.05	0.16		14.0	0.0		tr	1.69	2.01	250
Nitrate	< 0.01	< 0.10	< 0.01	< 0.01	< 0.01	< 0.01	< 0.5	0.20	1.7	< 0.5	< 0.01	< 0.01	< 0.01	10
Phosphate	< 0.01		< 0.01	4.80	< 0.01	8.23	~=				< 0.01	< 0.01	< 0.01	
l Fluoride	< 0.01	< 0.10	< 0.01	0.05	< 0.01	0.69	0.5		0.0		0.83	0.04	< 0.01	2.4
∞ Chloride	1.24		1.20	1.00	1.05	0.46		< 1.0	5.3		2.63	1,20	1.78	250
Bromide	< 0.01		< 0.01	< 0.01	< 0.01	< 0.01					< 0.01	< 0.01	< 0.03	
Silica	4.33		3.47	3.89	5.63	2.00			20		2,71	4.90	4.16	
goron	0.039		0.044	0.055	0.040	0.377					0.075	0.041	0.040	
Arsenic	< 0.002	0.002	0.012	0.021	< 0.002	< 0.002	0.015			< 0.005	< 0.002	< 0.002	< 0.002	0.05
Aluminum	0.034		0.037	0.066	0.008	0.036	< 0.040				0.039	0.037	0.048	
Copper	0.021		< 0.01	< 0.01	< 0.01	< 0.01	0.044		0.24		< 0.01	0.016	0.050	1
fron	0.158		0.195	0.443		0.066	0.037		0.02	0.045	0.660	0.056	0,061	0.3
Manganese	0.010		0.051	0.096		< 0.005	< 0.005	< 0.05	0.00	< 0.005	0.013	0.005	0.007	0.05
Lead	< 0.03	< 0.01	< 0.03	< 0.03	< 0.03	< 0.03	< 0,005	••	0.03	< 0.005	< 0.03	< 0.03	< 0.03	0.05
Zinc	0.048		0.008	0.005	0.120	0.028	0.020		0.24		0.272	0.943	1.384	5
Chromium	< 0.002	< 0.01	< 0.002	< 0.002	< 0.002	< 0.002	< 0.005		0.02	0.008	< 0.002	< 0.002	< 0.002	0.05
Selenium	< 0.02	< 0.001	< 0.02	< 0.02	< 0.02	< 0.02	< 0.002		0.01	< 0.002	< 0.02	< 0.02	< 0.02	0.01
Gross Alpha	< 1		< 1	< 1	, < 1	< 1	< 1			< 1	< 1	< 1	< 1	

DEC records.

USCS records.

CDEC/EPA Public Drinking Water recommended limits.

Explanation of table headings for Table 3

Well locations: Wells are located using the township, range, and section of the official rectangular subdivision of public lands (T. = township, R. = range, Sec. = section). Sections are divided into 2.5 aliquot parcels, and wells within each parcel are represented on Plate 1 by a single open circle. The circles, located on the center of the 2.5 acre parcels, are correlated to the text with map numbers. Note that all wells within a particular 2.5 acre parcel are assigned the same map number; therefore, a single map number may refer to two or more wells. Wells with the same map number are numbered sequentially. Thus, every well is uniquely described by township, range, section, sequence number, and map number.

Contractor: The name of the drilling company is given in preference to the individual operating the rig, when applicable.

Date completed: Date well installation completed as reported by owner or contractor.

Depth drilled: Maximum depth drilled in feet below land surface, as reported by owner or contractor.

Depth to water: Depth in feet to water as reported by owner or contractor (or government personnel involved in survey). Depths are assumed to represent a static water surface; that is, a natural level not influenced by recent withdrawal of water from the well. A non-static depth to water may be inadvertently reported as static in some instances.

Well yield: The rate, in gpm, that water has been extracted from the well during a short test period. Usually, this testing is accomplished by pumping or bailing for ½-2 hrs. Caution: this entry often does not reflect the long-term capacity of the well to supply water, and commonly either overstates or understates the full potential of the aquifer at that locality.

<u>Use</u>: Refers to the intended use of the well water at the time well data was acquired, normally when the well was drilled. C = commercial, H = domestic, P = public supply, T = institution, U = unused, Q = aquaculture.

<u>Property description</u>: Where available, legal descriptions (subdivision, lot, block) are used. In the absence of subdivisions, section number and appropriate tax lot number are used.

Table 3. Well data for the Houston, Alaska area. Includes water-supply wells, ground-water monitoring wells, and exploration wells.

_	_		quence	•		Date	Depth drilled	Depth to	Well yield		
<u>T.</u>	К.	Sec.	ло.	no.	Contractor	completed	(ft)	(ft)	(gpm)	Use	Property description
17N	3 W	1	1	1	Moon Drl	05-04-84	60		15	В	Meadowview Sub L6A 81
17N	3W	2	1	S	L&M Drl	10-28-77	85	56	10	H	Sec 2 Lot A18
17እ	3W	2	1	4	Gees Wtr Wls	08-30-85	78	68	10	н	Rainey Sub L6 81
17N	3W	2	3	1	Valley Drl	08-31-82	78	56	10	Н	Section 2
17N	3W	2	2	1	McKay Drl	09-03-83	98	75	12	н	Rainey Sub £4 B1
17N	3W	2	1	2	Unknown		129			н	Section 2 Lot A11
17N	3₩	2	1	6	Wheaton Wtr	11-08-83	121	70	15	H	Rainey Sub L2 B1
17N	3W	2	2	6	Penn Jersey Drl	05-11-84	115		15	н	Rainey Sub L3 B1
17N	3W	2	1	3	Magnuson Drl	03-19-84	110	32	150	T	Section 2 Lot 84
17N	3W	4	1	1	Owner	80-00-66	17	6		Н	
17N	3W	4	2	1	M-W Drl	08-22-84	79	23	10	н	Lake Mount Est L2 B1
17N	3W	4	1	4	Wheaton Wtr	11-27-81	80	20	6	н	Lakefront Sub L4
1.7N	3W	4	1	6	McKay Drl	00-00-83	42			Н	Lake Mount Est L5 B3
	3W	4	1	3	Hartner Drl	09-17-76	88	25	10	H	Lake Mount Est L5 86
17N	3W	4	1	5	Hartner Drl	06-21-80	35	Ō	20	H	Lake Mount Est L8 89
	3W	4	1	2	Moffitt Drl	05-26-70	39	36	10	Н	Beaver Lake
1 7N	3 W	8	1	1	D&E Dcl	10-30-76	54	24	10	н	Freeman Sub 1 L3 86
17N	3W	8	1	2	Blue Bear Drl	02~08-77	71	17	25	H	Freeman Sub 1 L15 B3
17N	3W	8	1	3	Triple M Cab	12-02-81	50	19	12	H	Freeman Sub 1 L1 B8
17N	3₩	8	1	4	Unknown	09-12-75	50	30	20	H	Freeman Sub 1 11 B3
	3₩	8	1	5	Moon Dri	06-04-79	50	22	15	H	Freeman Sub 1 L12 89
17N	3W	8	1	6	Triple M Cab	05-01-81	60	5	20	н	Freeman Sub 1 L1 B9
17N	3 W	9	1	2	Patrick	00-00-74	42	17	15	អ	Section 9
17N	3W	9	1	3	Larson L	00-00-64	56	26		H	
17N	3W	9	1	5	L&M Drl	06-27-73	56	6	~-	H	8eaver Lake Sub L8 B4
17N	3W	9	1	1	M-W Drī	06~11-75	56	10	5	H	Beaver Lake Sub L9 B6
17N	3₩	9	1	7	Patrick Bill	00-00-75	100			Н	Beaver Lake Sub L3 B7
17N	3W	9	1	4	G&G Drl	00-00-66	58	43	20	T	Wasilla Assembly Church Camp
17N	3₩	9	1	6	Giełarowski Drl	08-16-85	41	19	15	н	Texas Sub L15-16 B5
3 7 N	3W	10	1	1	Blue Bear Orl	08-28-82	51	22	5	н	Old Toby Town Sub £10 B1
	3₩		1	6	Gielarowski Drł	00~00-85	81	41	10	Н	Section 11 Lot A3
	3W		1	7	Wheaton Wtr	06-08-81	61	40	10	н	Section 11 Lot A15
	3₩		1	2	Valley Drl	07-19-82	54	6	12	H	Long Lake Sub L7 B1
	3₩		1	1	McKay Drl	07-09-77	42	9	30	н	Long Lake Sub L5 B2
	3W		1	4	ปก หก่อพก	00-00-75	43			H	Long Lake Sub Adl L7
	3W		2	4	Pioneer Drl	07-15-85	40	10	30	H	Long Lake Sub Ad1 £1
1 7N	3₩	37	1	3	Frontier Drl	05-07-84	50	20	20	Н	Long Lake Sub Ad1 L5
17N	3W	12	1	2	C&G Dr1	00-00-66	91	21	10	н	Section 32 Lot A8
	3W		1	7	Wheaton Wtr	06-08-81	61	40	10	Н	Section 12 Lot A15
17N	3₩	12	1	6	Unknown		46			Н	Section 12 Lot B6
	3₩		t	8	Wheaton With	07-08 - 82	163	55	15	Н	Capitol Corridors Sub L1 B1
17N	3W	12	3	1	Owner	00-00-58	12	8		Н	Section 12

- 10

	٦.	R.		uence	Map no.	Contractor	Date completed	Depth drilled (ft)	Depth to water (ft)	Well yield (gpm)	Use	Property description
												<u> </u>
		3₩		1	3	Unknown	** **	42		~-	Н	Section 12
	17N		12	1	5	ADH	12-00-62	14			ñ	Houston area
	17N		12	1	4	G&C Drl		25	7	15	Ţ	Big Lake Baptist Church
	17N		12	2	4	McKay Drl	10-21-83	65	17	15	T	Section 12 Lot D6
	3 /N	3W	12	1	10	Meshew Tommy	06-06-78	61		50	Н	Section 12 Lot D10
	17N	3W	13	1	7 -	Big Dipper	00-00-84	37		10	н	Woody Lake Est L2 B3
	17N	3₩	13	1	2 ~	G&C Drl	07-14-72	43	32	15	Н	Lakeway Woods Sub L6 B2
	17N	3₩	13	1	8	Wheaton Wtr	11-09-84	60	30	25	Н	Woody Lake Est L2 B1
	17N	3₩	13	1	9.	Wheaton Wtr	11-09-84	60	30	20	н	Woody Lake Est L1 B1
	17N	3₩	13	1	11.	Hood & Sons	10-20-85	105	13	15	H	Woody Lake Est L9 B1
	17N	3W	13	1	12-	Williams Jay	08-16-84	81	41	15	В	Woody Lake Est L12 B4
	17N		13	1	3 -	Unknown		50	24		Н	Woody Lake Est Adl L17 B4
	17N		13	1	21 .	Wheaton Wtr	13-09-83	60	30	10	Н	Woody Lake Est L10 B3
	17N	3W	13	1	1 .	M-W Drl	08-11-78	57		10	Н	Woody Lake South Sub L20 B1
	17N		13	1	13	Penn-Jersey	08-01-83	79		15	H	Woody Lake South Sub L17 B1
	17N		13	i	4 -	Unknown		69			н	Woody Lake South Sub £13 B1
	17N		13	i	10 1	Penn~Jersey	08-16-83	85	**	12	H	Woody Lake South Sub L16 83
	17N		13	i	14	Hartner Drl	09-01-77	53	33	10	H	Woody Lake South Sub L6 B1
	17N		13	2	14	Blue Bear Drl	00-00-76	120			H	Woody Lake South Sub L7 B1
	17N		13	ī	20	Penn-Jersey	00-00-78	78			H	Woody Lake South Sub L9 81
	17N		13	i	5	Penn-Jersey	05-14-85	110	26	30	ĸ	
	17N	_	13	i	15	Penn-Jersey	04-27-79	84	37	10	Н	Woody Lake South Sub L1 B1
ı	17N		13	í	16	Swanson Drl	05-22-83	79		15	H	Woody Lake South Sub L4 83
\vdash	17N		13	i	18			-				Woody Lake South Sub L9 B3
\vdash	17N		13	2	18	Blue Bear Drl	06-04-78	92	26	15	H	Woody Lake South Sub L25 81
1		_	_			Wheaton Wtr	01-20-83	140	25	25	н	Woody Lake South Sub L26 B1
	17N		13	1	19	Blue Bear Drl	07-26-81	86	20	15	Н	Woody Lake South Sub L2 B5
		3W			22	Meshew Tommy	05-00-78	86		20	Н	Woody Lake South Sub L3 B5
	17N		13	2	22	Blue Bear Drl	06-12-83	84	29	15	Н	Woody Lake South Sub L4 B5
	17N		13	1	6	T&T Dr?	07-22-84	96	50	3	Н	Woody Lake South Sub L6 B5
	1 /N	3₩	13	1	17	Blue Bear Drl	06-13-78	89	27	20	Н	Woody Lake South Sub L22 B3
		3₩		1	3	Owner		22			н	
	17N	3W	14	t	2	G&C Drl	00-00-70	84	0.7	10	H	Pailard Homestead
	17N		14	1	1	C&C Drl	00-00-65	41	13	10	Н	Big Lake Rd
	17N	3₩	14	1	4	Davis Drl	09-03-84	76	50	15	Н	Section 14 Lot D9
	17N	3W	15	1	13	Meshew Tommy	10-01-77	55	50	10	Н	Birch Park Sub L3 84
	17N	3W	15	1	4	H & H Drl	08-06-80	80	40	30	H	Big Lake Heights 1 L11 B3
	17N	3W	15	1	14	Houston Drl	00-00-77	50	30	52	н	Big Lake Heights L11 B4
	17N	3₩	15	1	3	Blue Bear Drl	05-30-81	82		15	Н	Big Lake Heights L14 B3
	17N	3W	15	1	5	Friesen Drl	08-19-83	100	15	60	Н	Big Lake Heights L3 B7
	17N		15	7	18	Friesen Drl	04-06-84	41	23	5	Н	Big Lake Heights L4 B2
	17N		15	1	6	Williams Jay	07-14-80	40	20	15	Н	Big Lake Heights L20 81
	17N		15	1	ž	Custom Wtr	07-07-79	52	30	8	H	Big Lake Heights L17 B1
	17N		15	i	8	Unknown		100			Н	Big Lake Heights 11 B3
	17N		15	i	š	Moan Dr1	07-26-83	80		40	H	Big Lake Heights L5 86
	17N		15	1	10	McKay Drl	11-15-84	70		30	Н	Big Lake Heights L18 B4
		3W		i	11	Wheaton Wtr	09-16-82	80	20	12	ä	Ma Barker Sub L3
							/				• • •	

	Τ.	R,	Sec.	equence	Map no.	Contractor	Date completed	Depth drilled (ft)	Depth to water (ft)	Well yield (gpm)	Use	Property description
	17N	3₩	15	2	11	Hartner Drl	08-20-76	80	20	8	Н	Ma Barker Sub L4
	17N		15	î	1	McKay Drl	09-19-76	33	12	15	Н	Ma Barker Sub L5
	17N		15	2	1	Custom Drl	07-26-76	50	30	8	H	Ma Barker Sub L9
	17N		15	1	12	Hartner Drl	06-18-78	30	15	10	H	Ma Barker Sub L6
	17N		15	1	15	Hartner Drl	07-13-76	40	19	10	K	Birch Park Sub £14 & 15 B3
	17N 17N		15 15	1	2 1 9	Hartner Drl Gielarowski Drl	11-26-76 06-05-85	120 81	46	20 10	H	Birch Park Sub Adi L11 82
	17N	_	15	1	16	Moon Drl	10-18-84	164		150	H	Birch Park Sub L4 B1
	17N		15	2	16	WWD Wtr Well	10-01-82	141	28	20	H	Birch Park Sub Adl LS B2 Birch Park Sub Adl L6 B2
	1 7N			1	17	Hartner Dr3	06-21-75	80	27	10	H	Birch Park Sub Adl L7 B2
	17N			1	4	Rebischke J	00-00-83	50			Ħ	Stephan Lake Sub 17
	17N		16	1	2	G&G Dr1		53	6	10	н	Rocky Lake Sub L12 B1
	1 7N		16	1	3	Western States	10-13-76	54	14	25	ឣ	Big Lake Fish Hatchery Duplex
	17N		16	2	3	Western States	11-18-76	46	9		Ĩ	Big Lake Fish Hatchery Well 2
	1.7N		16	3	3	Western States	**	31	8		Ţ	Big Lake Fish Hatchery Well 3
	17N		16	4	3	M-W Dri	02-16-78	31	7	54	Q	Big Lake Fish Hatchery Well A
	17N		16	5	3	M-W Dri	02-16-78	27	8	150	Q	Big Lake Fish Hatchery Well B
	178	_	16	6 7	3	M-W Drl	09-07-78	182	7 5	250	Q	Big Lake Fish Hatchery
	1 7N 1 7N		16 16	í	3 1	M-W Drl Hatch Drl	03-08-78 05-14-71	36 62	5	205 10	Q P	Big Lake Fish Hatchery Well D Rocky Lake
ı	18N		17	1	1	0wner	00-00-62	50	17		Н	Section 37
•	18N	_	17	3	4	Cielarowski	05-09-85	58	36	15	н	Section 17 Lot C4
12	1 8N		17	1	2	Unknown	00-00-65	135	82		U	Section 17 Lot C6
	18N		17	3	3	Moon Dr1	00-00-68	130			H	Section 17 Lot C6
1	1 8N	3₩	17	2	3	Moon Dr1	07-26-76	82		15	Н	Section 17 Lot C1
	18N	3₩	18	1	4	ปกหลอง ก	00-00-50	140			н	Section 18
	18N	3₩	18	1	2	Unknown	00-00-64	150			С	Section 18 Lot D3
	18N	3₩	18	1	3	G&G Dr1		118	96	10	С	Section 18
	1 8N	3₩	18	1	3	USBM	08-18-52	386		**		Section 18
	18N		20	ì	3	Denali Drl	08-02-84	35	12		Ţ	Section 20 Lot A4
	18N			2	3	Denali Drl	08-03-84	30	471		T	Section 20 Lot A4
	18N 18N			1 1	1 2	USBM USBM	11-10-51 08-05-52	481 1142	\$55 \$55			Matanuska coalfield Matanuska coalfield
	18N	3 W	21	t	12	Denali Drī	. 08-07-84	26	7	~~	Ŧ	Section 21 Lot A1
	18N		21	1	11	Anch G&O Dev	10-09-61	1627			บ	Rosetta #4
	18N	3₩	21	2	11	Hackathorn D	09-24-62	2407			ีย	Rosetta #4A
	181		21	1	3	Acme Drl	11-20-69	85	12		Н	Section 21
	1 8N		21	1	15 1	McKay Drl	03-19-81	137		6	H	Heath Hts Sub Tr A
	1 8N			2	15	McKay Drl	00-00-85	160	32		អ	Heath Hts Sub Tr A
	18N			1	2	G&C Drī	00~00-65	100	18	3	Ŧ	Heath Hts Sub Tr D
	18N			1	î	G&G Dr1	40.00.60	27	11	8	X	Section 21
	18N		_	§	9	Frontier Drl	12-08-69	141	18	3	Я	Bryant Sub No 1 L13
	18N		21	2	8 8	Meshew Tommy	00-00-70	43 30		50	Ç	Bryant Sub No 2 L8
	18N	2₩	21	1	a	Moffitt Dr}	00-00-70	30	11		н	Bryant Sub No 1 L8

	Τ.	R. :	Sec.	quence	Map	Contractor	Date completed	Depth drilled (ft)	Depth to water (ft)	Well yield (gpm)	Uşe	Property description
	18N	3W	21	1	6	Cratiot Dick	00-00-76	32			Н	Bryant Sub No 1 L1 & 2
	18N	_	21	2	6	Clements RE	00-00-72	26	10		H	Bryant Sub No 1 L 3
	1 BN		21	3	ě	Blue Bear Drl	11-16-78	280	48	2	H	Bryant Sub No 1 L3
	18N		21	ĩ	ž	Clements	00-00-74	33	12		H	Bryant Sub No 1 L6
	18N		21	2	7	Clements	07-00-72	23	12		H	Bryant Sub No 1 L7
	181		21	3	7		00-00-69	50	20		H	Bryant Sub No 1 L4
	18N		21	ī	10	Unknown		30	7		H	Bryant Sub No 2 L7
	18N		21	i	4	Clements	00-00-73	27	<u></u>		ċ	Bryant Sub No 2 L9
	18N		21	i	Š	Clements	00-00-73	25	4		บั	Bryant Sub No 2 L8
	18N		21	i	13	Meshew Tommy	06-15-78	55			н	Bryant Sub No 2 L8
	18N		22	1	2 ·	ADH	11-00-63	22			U	Section 22
	18N	3W	22	1	3.	Unknown	00~00-76	50	14		Н	Section 22
	1 8N	3W	22	1	6	Unknown		25	7		Ų	Bryant Sub No 2
	18N	3W	22	1	7 .	Owner	00~00-76	175			U	Bryant Sub No 2
	18N	3W	22	1	1	Owner	00-00-58	35	7		Ρ	Houston Lodge
	18N	3W	22	1	5	Moon Drl		51	48			Section 22
	1 8N	3₩	22	1	8	Blue Bear Drl	06-23-82	75	26	65		Houston Fire Department
	18N		22	1	9	Blue Bear Drl	05-29-81	100		25	± ~	Houston Wayside Park
	188	3W	22	1	4	Owner	00~00~59	28	20		В	Section 22
	18N		23	1	5 -	Meshew Tommsy	04-00-77	130	8		Н	Susitna Heights Sub L5 B5
ŀ	1 BN		23	2	5	Owner		30	20		Н	Susitna Heights Sub £4 B5
_	18N		23	3	5	Davis Well	03-04-83	38	9	4	Н	Susitna Heights Sub L5 B5
13	18N	-	23	4	5	Friesen_Drl	10-24-83	100	5	16	Н	Susitna Heights Sub L4 B5
1	18N	_	23	1	2	Meshew Tommy	06-28-77	125			Н	Susitna Heights Sub L5 B6
	18N		23	1	1	Trovero Dino		33	21		H	Susitna Heights Sub L5 B8
	18N		23	2	1	Trovero Dino	01-00-76	33	21		н	Susitna Heights Sub L4 B8
	1 8N		23	1	4	Unknown		32	27		Н	Susitna Heights Sub L6 88
	18N		23	2	4	Cielarowski	08-21-85	48	13	20	н	Susitna Heights Sub L6 88
	1 8N		23	1	6	Meshew Tommy	09-28-77	50		10	Н	Susitna Heights Sub L2 B7
	18N	3₩	23	1	3	Meshew Tommy	10-12-77	50	40	10	Н	Susitna Heights Sub L1 B8
	18N	3W	24	1	1	Blue Bear Drl	10-01-82	69	17	15	н	Section 24 Lot D11
	18N	3₩	25	1	1	M-W Drl	07-25-83	39	6	30	н	Enchanted Forest Sub L30 B4
	18N		25	1	2	Unknown	~~	50	8		H	Loch Haven Est L8 81
	18N		25	1	3	Penn-Jersey	03-03-83	127	101	10	H	Enchanted Forest Sub L26 B15
	18N		25	1	8	McKay Dr1		108			Н	Enchanted Forest Sub L9 B15
	18N		25	1	12	Moon Drl	05-23-84	81	73	60	Н	Enchanted Forest Sub L2 B24
	18N		25	1	9	Delta Drl	~-	217	142	10	н	Enchanted Forest Sub L6A B31
	18N		25	1	4	Holohan Drl	07-18-85	120	110	20	Ĥ	Enchanted Forest Sub L5 B29
	18N		25	1	5	Unknown	00-00-78	117			H	Enchanted Forest Sub L6 B26
	18N		25	1	11	Moon Dr1	10-25-84	141		40	H	Enchanted Forest Sub L9 B26
	18N	_	25	1	6	Friesen Drl	06-28-85	122	116	8	R	Enchanted Forest Sub &8 828
	181	_	25	1	7	Penn-Jersey	04-30-79	134	126	Š	H	Enchanted Forest Sub L11 B28
	18N		25	1	10	McKay Drl	08-16-83	135	118	12	Н	Enchanted Forest Sub L15 B32
	1 BN		25	2	10	Unknown	07-00-82	109	~-		H	Enchanted Forest Sub L1 B33

.

	т.	R. S	Sec.	quence	Map	Contractor	Date completed	Depth drilled (ft)	Depth to water (ft)	Well yield (gpm)	Use	Property description
	1.8N	3W 2	26	1	3 -	Unknows	00-00-78	36	* ~	60	H	Enchanted Forest Sub L1 B7
	-	3W 2		1	6	Blue Bear Orl	00-00-82	103			H	Enchanted Forest Sub L6 B7
		3W 2		í	ĭ.	Meshew Tomry	06-10-77	41		0.8	B	Enchanted Forest Sub L2 83
	-	3W 2		i	ż	Ожлес	00-00-75	12			Ĥ	Enchanted Forest Sub L6 89
		3W 2		i	13	Pioneer Drl	08-30-84	40	7	75	н	Enchanted Forest Sub L8 89
		3W 2		1	8	Denali Dri	09-01-84	30	12	12	Н	Enchanted Forest Sub L2 B13
		3W 2		1	9	Durbin Drl	05-07-84	38	16	30	н	Enchanted Forest Sub L2 B10
		3W 2		1	4	Moon Drl	08-16-84	161		17	H	Enchanted Forest Sub L09 B13
	1 8N	3W 2	26	2	4	Moon Drl	08-16-85	161		11	н	Enchanted Forest Sub L19 B13
	1.8N	3W 2	26	3	4	Moon Drl	06-25-84	151			H	Enchanted Forest Sub L18 B13
	18N	3W 2	26	1	10	Valley Drl	07-11-79	140	124	8	н	Enchanted Forest Sub L21 B16
	18N	3W 2	26	2	10	Moon Drl	11-27-78	146		5	Ħ	Enchanted Forest Sub L20 B16
	181	3W 2	26	1	11	McKay Drl	03-03-83	128	114	15	Н	Enchanted Forest Sub L2 B15
	18N	3W 2	?6	1	12	Moon Drl	05-22-80	162	146	12	Н	Enchanted Forest Sub L2 B16
	1 BN	3₩ 2	26	1	5	Unknown	00-00-85	160	~-	13	H	Enchanted Forest Sub L1 816
	18N	3₩ 2	26	1	2	Valley Drl	08-27-82	150	135	10	H	Enchanted Forest Sub L4 B16
	1.8N	3W 2	77	1	1	Owner	00~00-55	15			н	Section 27
		3W 2		1	2	Unknown	00-00-60	105			н	Section 27 Lot 07
	1 8N	3W 3	32	1	1.	Lovely Lum	02-09-70	8454			ย	Section 32
ı	18N	3W 3	34	3	1	Unknown		100			н	Horizon West Sub 1 L1 83
	18N	3W 3	34	2	1	Friesen Drl	07~00-84	65			Н	Horizon West Sub 1 L4 81
14	18N	3W 3	34	1	4 .	ปกหกอพท	00-00-54	80			н	Section 34 Lot A6
	18N	3W 3	34	1	5	Wheaton Wtr	00-00-82	147			Н	Section 34 Lot A5
ı	18N	3W 3	34	1	2	Williams Jay	08-08-84	100	60	10	Н	Horizon West Sub 1 L8 B1
		3W 3		1	6	Wheaton Wtr		97			н	Section 34 Lot 84
	_	3₩ 3		2	6	Wheaton Wtr		97			Н	Section 34 Lot 84
		3₩ 3		1	7	Moon Drl	00~00-74				В	Section 34 Lot 84
	18N	3W 3	34	1	3	0wner	00-00-53	16			U	Section 34 Lot D1
		3W 3		1	12	Unknown	~-	86			Н	Bearpaw Lake Sub L4 B2
		3W 3		1	13 -	Unknown	 01 07 05	125			н	Bearpaw Lake Sub L11 B6
		3W 3		1	4	Moon Dr I	04~07-82	86		10	H	Dehart Acres Sub L1
		3W 3		1	1	M-W Dc1	05-07-76	86	68	10	н	Dehart Acres Sub L2 B1
		3W 3		1	2	Hartner Orl	06-24-76	88	60	10	Ħ	Section 35 Lot B1
		3W 3	_	1	3	Wheaton Wtr	11-09-83	60	25	15	В	Horizon West Sub 1 L2 B5
		3W 3		1	5 6	Penn-Jersey	01-03-85	44 49	~-	.8	H	Gaunt Sub L4 81 Gaunt Sub L10 B1
		3W 3				Penn-Jersey	04-18-85	78	54	15	л Н	Gaunt Sub L12 B2
		3W 3		3 1	7 8	McKay Dri Unknown	10-09-84 00-00-75	57	5 4	15	Н	Tall Birch Sub 1 2nd Rplt £3 83
		3W 3		2	8	McKay Drl	08-09-82	102	88	12	'' H	Tall Birch Sub £4 83
		3W 3		1	9	Wilson Well Dri	12-00-75	115			H	Tall Birch Sub 1 2nd Rolt L1 B3
		3W 3		1	10	Valley Dri	00-00-79	89			H	Tall Birch Sub 1 2nd Rplt L8 B1
	_	3W 3		1	11	CB Or)	06-12-78	80	40	6	H	Tall Birch Sub 1 2nd Rplt L1 B1
	1 <i>8</i> N	3W 3	36	1	3	McKay Dri	03-21-80	124	170	6	н	Cheri Lake Sub L31 B3
		3W 3		į	2	McKay Drl	06-05-80	80	66	5	н	Cheri Lake Sub L2 B2
						•						